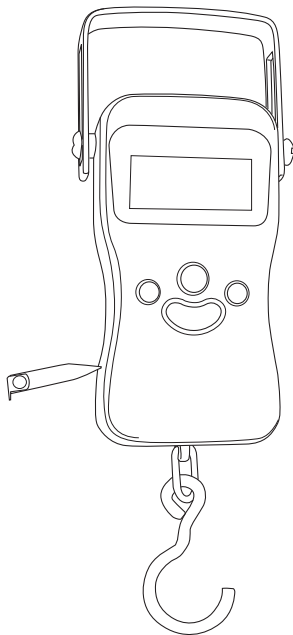# UltraSport™ V2

Hanging Digital Handheld Fishing & Utility Scale

30 Capacity	66lb x 0.02lb / 30kg x 0.01kg
50 Capacity	110lb x 0.04lb / 50kg x 0.02kg
Units	kg / lb / oz
Calibration weight	20kg
Minimum weight	40g
Auto Off	60 seconds
Power source	2x CR2032 batteries

Thank you for purchasing the J-Scale® Ultrasport™ V2 digital scale. Please read all operating instructions carefully before use. This electronic scale is a precision instrument. With normal care and proper treatment, it will provide years of reliable service.

For further information or troubleshooting, please visit our website at **www.jscale.com**

OPERATING INSTRUCTIONS

1. Press ON/OFF key to turn the scale ON,
2. wait till "0.00" is displayed,
3. put the object(s) onto the hook,
4. using SET key, you can switch among the weighing units.

Tare Function
1. Turn the scale on as described above
2. Wait till "0.00" is displayed
3. Put the tare item onto the hook
4. Press TARE key to zero the scale
5. Put the "net-weight-item" onto the hook

Reading Lock & Memory Setting
1. Put the object(s) onto the hook, wait till the reading get stable, press HOLD to lock the current reading
2. The reading will get unlocked after 10 seconds of inactivity
3. You can get the reading unlocked at any time by pressing TARE key

Memory Setting
1. The reading will be in memorized automatically after you get it locked
2. You can enter into the memory retrieving mode by pressing and holding the SET key for 3 seconds
3. Click the TARE key, you can switch among the latest 10 readings in memory.

Temperature Setting
1. Turn the scale ON, wait till "0.00" is displayed
2. You can enter into Temperature Mode by pressing and holding TARE key for 3 seconds
3. Exit from Temperature Mode by clicking ON/OFF key

Calibration
1. Turn the Scale off first,
2. Press and Hold the ON/OFF key and SET key till a random number is displayed
3. Press the SET key, the LCD will display CAL followed the required calibration weight
4. Put the required calibration weight onto the hook
5. The LCD will show PASS and return to the normal weighing mode
6. Put away the calibration weight and press ON/OFF key to turn the scale off. Calibration is finished.